

Uniform Mitigation Verification Inspection Form

Maintain a copy of this form and any documentation provided with the insurance policy

Inspection Date:		
Owner Information		
Owner Name:		Contact Person:
Address:		Home Phone:
City:	Zip:	Work Phone:
County:		Cell Phone:
Insurance Company:		Policy #:
Year of Home:	# of Stories:	Email:

NOTE: Any documentation used in validating the compliance or existence of each construction or mitigation attribute must accompany this form. At least one photograph must accompany this form to validate each attribute marked in questions 3 through 7. The insurer may ask additional questions regarding the mitigated feature(s) verified on this form.

- Building Code:** Was the structure built in compliance with the Florida Building Code (FBC 2001 or later) OR for homes located in the HVHZ (Miami-Dade or Broward counties), South Florida Building Code (SFBC-94)?
 - A. Built in compliance with the FBC: Year Built _____. For homes built in 2002/2003 provide a permit application with a date after 3/1/2002: Building Permit Application Date (MM/DD/YYYY) ____/____/_____
 - B. For the HVHZ Only: Built in compliance with the SFBC-94: Year Built _____. For homes built in 1994, 1995, and 1996 provide a permit application with a date after 9/1/1994: Building Permit Application Date (MM/DD/YYYY) ____/____/_____
 - C. Unknown or does not meet the requirements of Answer "A" or "B"
- Roof Covering:** Select all roof covering types in use. Provide the permit application date OR FBC/MDC Product Approval number OR Year of Original Installation/Replacement OR indicate that no information was available to verify compliance for each roof covering identified.

2.1 Roof Covering Type:	Permit Application Date	FBC or MDC Product Approval #	Year of Original Installation or Replacement	No Information Provided for Compliance
<input type="checkbox"/> 1. Asphalt/Fiberglass Shingle	____/____/____	_____	_____	<input type="checkbox"/>
<input type="checkbox"/> 2. Concrete/Clay Tile	____/____/____	_____	_____	<input type="checkbox"/>
<input type="checkbox"/> 3. Metal	____/____/____	_____	_____	<input type="checkbox"/>
<input type="checkbox"/> 4. Built Up	____/____/____	_____	_____	<input type="checkbox"/>
<input type="checkbox"/> 5. Membrane	____/____/____	_____	_____	<input type="checkbox"/>
<input type="checkbox"/> 6. Other _____	____/____/____	_____	_____	<input type="checkbox"/>

- A. All roof coverings listed above meet the FBC with a FBC or Miami-Dade Product Approval listing current at time of installation OR have a roofing permit application date on or after 3/1/02 OR the roof is original and built in 2004 or later.
- B. All roof coverings have a Miami-Dade Product Approval listing current at time of installation OR (for the HVHZ only) a roofing permit application after 9/1/1994 and before 3/1/2002 OR the roof is original and built in 1997 or later.
- C. One or more roof coverings do not meet the requirements of Answer "A" or "B".
- D. No roof coverings meet the requirements of Answer "A" or "B".

- Roof Deck Attachment:** What is the weakest form of roof deck attachment?
 - A. Plywood/Oriented strand board (OSB) roof sheathing attached to the roof truss/rafter (spaced a maximum of 24" inches o.c.) by staples or 6d nails spaced at 6" along the edge and 12" in the field. -OR- Batten decking supporting wood shakes or wood shingles. -OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that has an equivalent mean uplift less than that required for Options B or C below.
 - B. Plywood/OSB roof sheathing with a minimum thickness of 7/16" inch attached to the roof truss/rafter (spaced a maximum of 24" inches o.c.) by 8d common nails spaced a maximum of 12" inches in the field. -OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent or greater resistance 8d nails spaced a maximum of 12 inches in the field or has a mean uplift resistance of at least 103 psf.
 - C. Plywood/OSB roof sheathing with a minimum thickness of 7/16" inch attached to the roof truss/rafter (spaced a maximum of 24" inches o.c.) by 8d common nails spaced a maximum of 6" inches in the field. -OR- Dimensional lumber/Tongue & Groove decking with a minimum of 2 nails per board (or 1 nail per board if each board is equal to or less than 6 inches in width). -OR- Any system of screws, nails, adhesives, other deck fastening system or truss/rafter spacing that is shown to have an equivalent

Inspectors Initials _____ Property Address _____

***This verification form is valid for up to five (5) years provided no material changes have been made to the structure.**

or greater resistance than 8d common nails spaced a maximum of 6 inches in the field or has a mean uplift resistance of at least 182 psf.

- D. Reinforced Concrete Roof Deck.
- E. Other: _____
- F. Unknown or unidentified.
- G. No attic access.

4. **Roof to Wall Attachment:** What is the **WEAKEST** roof to wall connection? (Do not include attachment of hip/valley jacks within 5 feet of the inside or outside corner of the roof in determination of WEAKEST type)

- A. Toe Nails
 - Truss/rafter anchored to top plate of wall using nails driven at an angle through the truss/rafter and attached to the top plate of the wall, or
 - Metal connectors that do not meet the minimal conditions or requirements of B, C, or D

Minimal conditions to qualify for categories B, C, or D. All visible metal connectors are:

- Secured to truss/rafter with a minimum of three (3) nails, **and**
- Attached to the wall top plate of the wall framing, or embedded in the bond beam, with less than a 1/2" gap from the blocking or truss/rafter **and** blocked no more than 1.5" of the truss/rafter, **and** free of visible severe corrosion.
- B. Clips
 - Metal connectors that do not wrap over the top of the truss/rafter, **or**
 - Metal connectors with a minimum of 1 strap that wraps over the top of the truss/rafter and does not meet the nail position requirements of C or D, but is secured with a minimum of 3 nails.
- C. Single Wraps
 - Metal connectors consisting of a single strap that wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side and a minimum of 1 nail on the opposing side.
- D. Double Wraps
 - Metal Connectors consisting of 2 separate straps that are attached to the wall frame, or embedded in the bond beam, on either side of the truss/rafter where each strap wraps over the top of the truss/rafter and is secured with a minimum of 2 nails on the front side, and a minimum of 1 nail on the opposing side, **or**
 - Metal connectors consisting of a single strap that wraps over the top of the truss/rafter, is secured to the wall on both sides, and is secured to the top plate with a minimum of three nails on each side.
- E. Structural Anchor bolts structurally connected or reinforced concrete roof.
- F. Other: _____
- G. Unknown or unidentified
- H. No attic access

5. **Roof Geometry:** What is the roof shape? (Do not consider roofs of porches or carports that are attached only to the fascia or wall of the host structure over unenclosed space in the determination of roof perimeter or roof area for roof geometry classification).

- A. Hip Roof Hip roof with no other roof shapes greater than 10% of the total roof system perimeter.
Total length of non-hip features: _____ feet; Total roof system perimeter: _____ feet
- B. Flat Roof Roof on a building with 5 or more units where at least 90% of the main roof area has a roof slope of less than 2:12. Roof area with slope less than 2:12 _____ sq ft; Total roof area _____ sq ft
- C. Other Roof Any roof that does not qualify as either (A) or (B) above.

6. **Secondary Water Resistance (SWR):** (standard underlayments or hot-mopped felts do not qualify as an SWR)

- A. SWR (also called Sealed Roof Deck) Self-adhering polymer modified-bitumen roofing underlayment applied directly to the sheathing or foam adhesive SWR barrier (not foamed-on insulation) applied as a supplemental means to protect the dwelling from water intrusion in the event of roof covering loss.
- B. No SWR.
- C. Unknown or undetermined.

Inspectors Initials _____ **Property Address** _____

***This verification form is valid for up to five (5) years provided no material changes have been made to the structure or inaccuracies found on the form.**

7. **Opening Protection:** What is the **weakest** form of wind borne debris protection installed on the structure? **First**, use the table to determine the weakest form of protection for each category of opening. **Second**, (a) check one answer below (A, B, C, N, or X) based upon the lowest protection level for ALL Glazed openings **and** (b) check the protection level for all Non-Glazed openings (.1, .2, or .3) as applicable.

Opening Protection Level Chart Place an "X" in each row to identify all forms of protection in use for each opening type. Check only one answer below (A thru X), based on the weakest form of protection (lowest row) for any of the Glazed openings and indicate the weakest form of protection (lowest row) for Non-Glazed openings.		Glazed Openings				Non-Glazed Openings	
		Windows or Entry Doors	Garage Doors	Skylights	Glass Block	Entry Doors	Garage Doors
N/A	Not Applicable- there are no openings of this type on the structure						
A	Verified cyclic pressure & large missile (9-lb for windows doors/4.5 lb for skylights)						
B	Verified cyclic pressure & large missile (4-8 lb for windows doors/2 lb for skylights)						
C	Verified plywood/OSB meeting Table 1609.1.2 of the FBC 2007						
D	Verified Non-Glazed Entry or Garage doors indicating compliance with ASTM E 330, ANSI/DASMA 108, or PA/TAS 202 for wind pressure resistance						
N	Opening Protection products that appear to be A or B but are not verified						
	Other protective coverings that cannot be identified as A, B, or C						
X	No Windborne Debris Protection						

- A. Exterior Openings Cyclic Pressure and 9-lb Large Missile (4.5 lb for skylights only)** All Glazed openings are protected at a minimum, with impact resistant coverings or products listed as wind borne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level A in the table above).
- Miami-Dade County PA 201, 202, **and** 203
 - Florida Building Code Testing Application Standard (TAS) 201, 202, **and** 203
 - American Society for Testing and Materials (ASTM) E 1886 **and** ASTM E 1996
 - Southern Standards Technical Document (SSTD) 12
 - For Skylights Only: ASTM E 1886 **and** ASTM E 1996
 - For Garage Doors Only: ANSI/DASMA 115
- A.1 All Non-Glazed openings classified as A in the table above, or no Non-Glazed openings exist
- A.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level B, C, N, or X in the table above
- A.3 One or More Non-Glazed Openings is classified as Level B, C, N, or X in the table above
- B. Exterior Opening Protection- Cyclic Pressure and 4 to 8-lb Large Missile (2-4.5 lb for skylights only)** All Glazed openings are protected, at a minimum, with impact resistant coverings or products listed as windborne debris protection devices in the product approval system of the State of Florida or Miami-Dade County and meet the requirements of one of the following for "Cyclic Pressure and Large Missile Impact" (Level B in the table above):
- ASTM E 1886 **and** ASTM E 1996 (Large Missile – 4.5 lb.)
 - SSTD 12 (Large Missile – 4 lb. to 8 lb.)
 - For Skylights Only: ASTM E 1886 **and** ASTM E 1996 (Large Missile - 2 to 4.5 lb.)
- B.1 All Non-Glazed openings classified as A or B in the table above, or no Non-Glazed openings exist
- B.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level C, N, or X in the table above
- B.3 One or More Non-Glazed openings is classified as Level C, N, or X in the table above
- C. Exterior Opening Protection- Wood Structural Panels meeting FBC 2007** All Glazed openings are covered with plywood/OSB meeting the requirements of Table 1609.1.2 of the FBC 2007 (Level C in the table above).
- C.1 All Non-Glazed openings classified as A, B, or C in the table above, or no Non-Glazed openings exist
- C.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level N or X in the table above
- C.3 One or More Non-Glazed openings is classified as Level N or X in the table above

Inspectors Initials _____ Property Address _____

***This verification form is valid for up to five (5) years provided no material changes have been made to the structure or inaccuracies found on the form.**

- N. Exterior Opening Protection (unverified shutter systems with no documentation)** All Glazed openings are protected with protective coverings not meeting the requirements of Answer "A", "B", or "C" or systems that appear to meet Answer "A" or "B" with no documentation of compliance (Level N in the table above).
 - N.1 All Non-Glazed openings classified as Level A, B, C, or N in the table above, or no Non-Glazed openings exist
 - N.2 One or More Non-Glazed openings classified as Level D in the table above, and no Non-Glazed openings classified as Level X in the table above
 - N.3 One or More Non-Glazed openings is classified as Level X in the table above
- X. None or Some Glazed Openings** One or more Glazed openings classified and Level X in the table above.

MITIGATION INSPECTIONS MUST BE CERTIFIED BY A QUALIFIED INSPECTOR. <i>Section 627.711(2), Florida Statutes, provides a listing of individuals who may sign this form.</i>		
Qualified Inspector Name:	License Type:	License or Certificate #:
Inspection Company:		Phone:

Qualified Inspector – I hold an active license as a: (check one)

- Home inspector licensed under Section 468.8314, Florida Statutes who has completed the statutory number of hours of hurricane mitigation training approved by the Construction Industry Licensing Board and completion of a proficiency exam.
- Building code inspector certified under Section 468.607, Florida Statutes.
- General, building or residential contractor licensed under Section 489.111, Florida Statutes.
- Professional engineer licensed under Section 471.015, Florida Statutes.
- Professional architect licensed under Section 481.213, Florida Statutes.
- Any other individual or entity recognized by the insurer as possessing the necessary qualifications to properly complete a uniform mitigation verification form pursuant to Section 627.711(2), Florida Statutes.

Individuals other than licensed contractors licensed under Section 489.111, Florida Statutes, or professional engineer licensed under Section 471.015, Florida Statutes, must inspect the structures personally and not through employees or other persons. Licensees under s.471.015 or s.489.111 may authorize a direct employee who possesses the requisite skill, knowledge, and experience to conduct a mitigation verification inspection.

I, _____ am a qualified inspector and I personally performed the inspection or (*licensed contractors and professional engineers only*) I had my employee (_____) perform the inspection
 (print name) (print name of inspector)
 and I agree to be responsible for his/her work.

Qualified Inspector Signature: Adrian Palma Date: _____

An individual or entity who knowingly or through gross negligence provides a false or fraudulent mitigation verification form is subject to investigation by the Florida Division of Insurance Fraud and may be subject to administrative action by the appropriate licensing agency or to criminal prosecution. (Section 627.711(4)-(7), Florida Statutes) The Qualified Inspector who certifies this form shall be directly liable for the misconduct of employees as if the authorized mitigation inspector personally performed the inspection.

Homeowner to complete: I certify that the named Qualified Inspector or his or her employee did perform an inspection of the residence identified on this form and that proof of identification was provided to me or my Authorized Representative.


Signature: _____ Date: _____

An individual or entity who knowingly provides or utters a false or fraudulent mitigation verification form with the intent to obtain or receive a discount on an insurance premium to which the individual or entity is not entitled commits a misdemeanor of the first degree. (Section 627.711(7), Florida Statutes)




The definitions on this form are for inspection purposes only and cannot be used to certify any product or construction feature as offering protection from hurricanes.

Inspectors Initials _____ Property Address _____


*This verification form is valid for up to five (5) years provided no material changes have been made to the structure or inaccuracies found on the form.

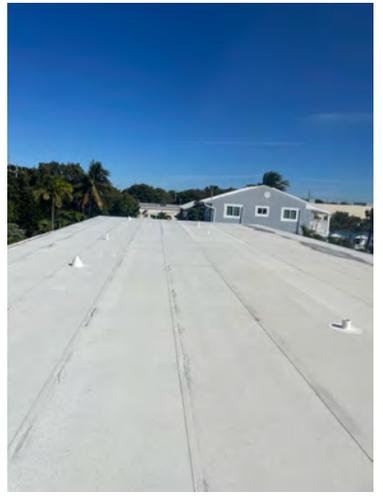


2016 FBC Miami Dade
Membrane Roof

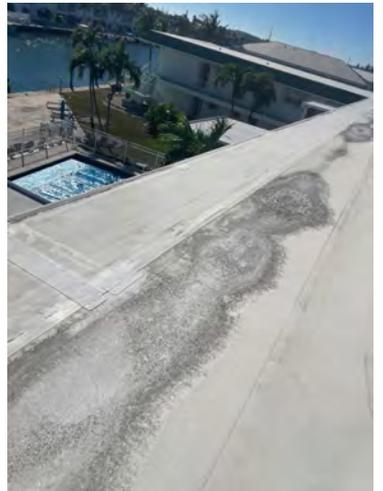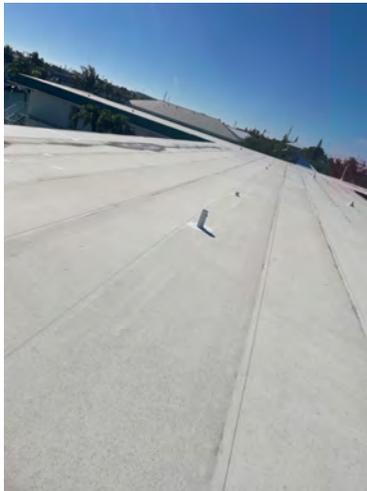
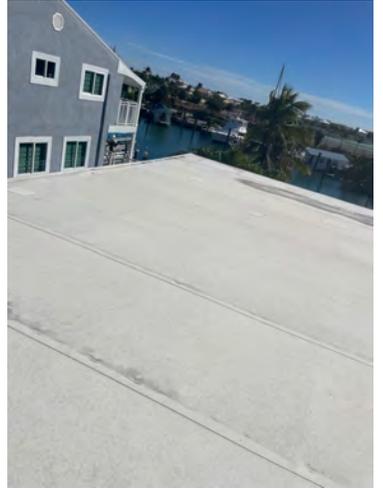


2016 FBC Miami Dade
Membrane Roof

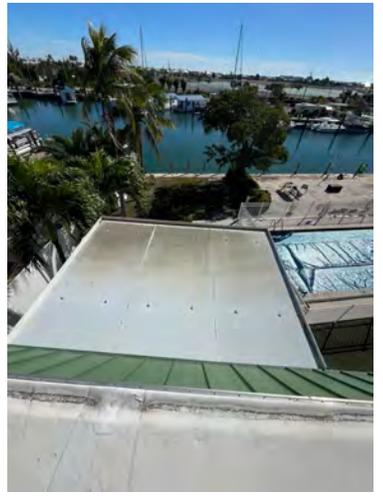

2016 FBC Miami Dade
Membrane Roof

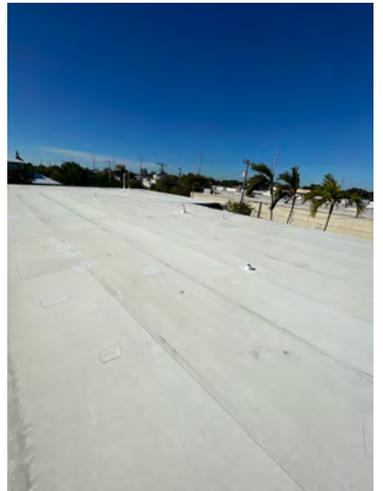

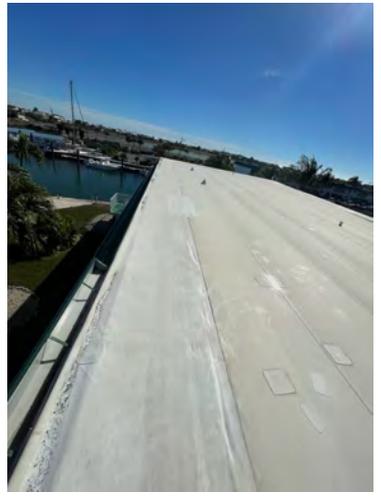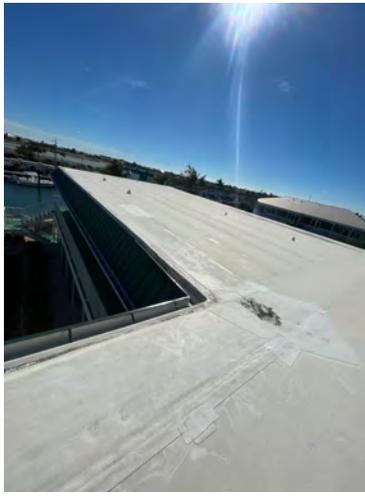

2016 FBC Miami Dade
Membrane Roof



East Face



South Face




West Face



100% 9lb Missile Impact Resistant Openings



100% 9lb Missile Impact Resistant Openings

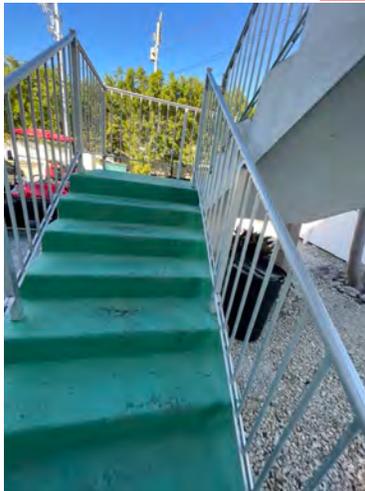

Attic Access



Single Strap Over Truss



Single Strap Over Truss



8D Nails Spaced 6" O.C



5/8" Plywood Sheathing
Roof Deck





100% 9lb Missile Impact Rated Openings



Miami Dade Product Approval





100% 9lb Missile Impact
Rated Openings



Miami Dade Product
Approval



DEPARTMENT OF REGULATORY AND ECONOMIC RESOURCES (RER)
BOARD AND CODE ADMINISTRATION DIVISION

MIAMI-DADE COUNTY
PRODUCT CONTROL SECTION
11805 SW 26 Street, Room 208
Miami, Florida 33175-2474
T (786) 315-2590 F (786) 315-2599
www.miamidade.gov/pera

NOTICE OF ACCEPTANCE (NOA)

Versico, a division of Carlisle Construction Materials Incorporated
PO Box 1289
Carlisle, PA 17013

Roof:
2016 FBC
MIAMI DADE MEMBRANE"

SCOPE:

This NOA is being issued under the applicable rules and regulations governing the use of construction materials. The documentation submitted has been reviewed and accepted by Miami-Dade County RER - Product Control Section to be used in Miami Dade County and other areas where allowed by the Authority Having Jurisdiction (AHJ).

This NOA shall not be valid after the expiration date stated below. The Miami-Dade County Product Control Section (In Miami Dade County) and/or the AHJ (in areas other than Miami Dade County) reserve the right to have this product or material tested for quality assurance purposes. If this product or material fails to perform in the accepted manner, the manufacturer will incur the expense of such testing and the AHJ may immediately revoke, modify, or suspend the use of such product or material within their jurisdiction. RER reserves the right to revoke this acceptance, if it is determined by Miami-Dade County Product Control Section that this product or material fails to meet the requirements of the applicable building code.

This product is approved as described herein, and has been designed to comply with the Florida Building Code including the High Velocity Hurricane Zone of the Florida Building Code.

DESCRIPTION: Versico VersiWeid Single Ply TPO Roof Systems over Wood Decks

LABELING: Each unit shall bear a permanent label with the manufacturer's name or logo, city, state and following statement: "Miami-Dade County Product Control Approved", unless otherwise noted herein.

RENEWAL of this NOA shall be considered after a renewal application has been filed and there has been no change in the applicable building code negatively affecting the performance of this product.

TERMINATION of this NOA will occur after the expiration date or if there has been a revision or change in the materials, use, and/or manufacture of the product or process. Misuse of this NOA as an endorsement of any product, for sales, advertising or any other purposes shall automatically terminate this NOA. Failure to comply with any section of this NOA shall be cause for termination and removal of NOA.

ADVERTISEMENT: The NOA number preceded by the words Miami-Dade County, Florida, and followed by the expiration date may be displayed in advertising literature. If any portion of the NOA is displayed, then it shall be done in its entirety.

INSPECTION: A copy of this entire NOA shall be provided to the user by the manufacturer or its distributors and shall be available for inspection at the job site at the request of the Building Official.

This renews NOA# 13-0219.19 and consists of pages 1 through 8.
The submitted documentation was reviewed by Alex Tigera.



Alex Tigera

SYSTEM: PAGE 7, # 1

NOA No.: 14-0626.11
Expiration Date: 08/31/18
Approval Date: 09/04/14
Page 1 of 8

Monroe County, FL

PROPERTY RECORD CARD

Disclaimer

The Monroe County Property Appraiser's office maintains data on property within the County solely for the purpose of fulfilling its responsibility to secure a just valuation for ad valorem tax purposes of all property within the County. The Monroe County Property Appraiser's office cannot guarantee its accuracy for any other purpose. Likewise, data provided regarding one tax year may not be applicable in prior or subsequent years. By requesting such data, you hereby understand and agree that the data is intended for ad valorem tax purposes only and should not be relied on for any other purpose.

By continuing into this site you assert that you have read and agree to the above statement.

Summary

Parcel ID 00325131-000000
Account# 1399094
Property ID 1399094
Millage Group 50CM
Location 5301 OCEAN Ter 1-16, MARATHON
Address
Legal Description TRADE WINDS WEST CONDOMINIUM INC PT LOTS 3&4 BLOCK J& PT LOTS 1&2 BLOCK K MARMEADE SUB PB3-185 MARATHON FLORIDA OR549-581/663DEC OR885-1822/1823AMD OR1563-573/580AMD OR1631-1652/53AMD OR1717-722/723AMD OR1733-1929AMD OR2457-446/447AMD OR3262-874AMD
(Note: Not to be used on legal documents.)
Neighborhood 8264
Property Class CONDO HEADER (4H00)
Subdivision MARAMEADE AMD
Sec/Twp/Rng 11/66/32
Affordable Housing No



Owner

TRADE WINDS WEST CONDOMINIUM

Valuation

	2024 Certified Values	2023 Certified Values	2022 Certified Values	2021 Certified Values
+ Market Improvement Value	\$0	\$0	\$0	\$0
+ Market Misc Value	\$0	\$0	\$0	\$0
+ Market Land Value	\$0	\$0	\$0	\$0
= Just Market Value	\$0	\$0	\$0	\$0
= Total Assessed Value	\$0	\$0	\$0	\$0
- School Exempt Value				
= School Taxable Value				

Historical Assessments

Year	Land Value	Building Value	Yard Item Value	Just (Market) Value	Assessed Value	Exempt Value	Taxable Value	Maximum Portability
2024	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
2023	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
2022	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
2021	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
2020	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
2019	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0
2018	\$0	\$0	\$0	\$0	\$0	\$0	\$0	\$0

The Maximum Portability is an estimate only and should not be relied upon as the actual portability amount. Contact our office to verify the actual portability amount.

Permits

Number	Date Issued	Status	Amount	Permit Type	Notes
P-24-512	05/24/2024	Active	\$65,000	Residential	7- Move washing machines to new location 1- new sewer to all washing machines 2- floor drain 3- new hot and cold-water supply to washer boxes Part B (CONCRETE CUTTING & OUTSIDE SEWER LATERIAL INSTALLATION) Lay out drop cloths from ceiling to floor in area where work is going to be performed. Chip and dispose of concrete and dirt for the 2 trenches inside each unit. Chip and dispose of concrete and dirt for the main sewer lateral in hall-ways of unit.
P-22-589	11/15/2022	Completed	\$5,000	Residential	RECERTIFICATION: ELECTRICAL REPAIRS - REPLACE BD GFIS, SWITCHES & SMOKE DETECTORES IF NEEDED.
P-22-696	10/28/2022	Completed	\$11,900	Residential	ROOF REPAIRS
P-22-817	10/05/2022	Active	\$68,000	Residential	STRUCTURE: DEMO & REPAIR SPALLING AREAS - APPROX 116 CF PUMP HOUSE: REMOVE POOL EQUIP, REROUTE PLUMBING & ELECTRIC TO TEMPL SLAB WHILE REPAIRING POOL EQUIP. ROOM. - REPAIR POOL EQUIP. ROOM (S2) - MOVE EVERYTHING BACK FROM TEMP. LOCATION.
W2019-3202	09/27/2019	Active	\$95,000	Residential	REMOVE/REPLACE CONCRETE CAP, FORM & POUR NEW CONCRETE BEAMS, FORM & POUR CONCRETE CAP
E2017-3584	12/04/2017	Completed	\$1,900	Residential	REPLACE ELECTRIC TO SWIMMING POOL EQUIPMENT DUE TO HURR. IRMA
P2017-0678	06/19/2017	Active	\$191,605	Residential	Spalling Repairs (Building 2) **8/30/17 - Rec'd Rev#1 - Steel column footer. (\$2,750)**MM

Number	Date Issued	Status	Amount	Permit Type	Notes
P2017-0122	02/07/2017	Completed	\$1,000	Residential	Replace fender mounting brackets (see pics) near docks.
P2016-0313	03/17/2016	Completed	\$57,400	Residential	REPLACE FLAT ROOF - 9,000 SF
P2012-1153	07/09/2012	Completed	\$4,700	Residential	DEMOLITION OF EXISTING WWTP PLANT. SEE P2010-0442.
72012-0814	04/24/2012	Completed	\$1,400	Residential	REPAVING 250 SF.
P2011-1590	02/16/2011	Completed	\$7,850	Residential	repair to elevated walkway where defective, chase and fill 40 cracks. walkway needs repair now
P2010-0604	05/03/2010	Completed	\$18,000	Residential	CONSTRUCTION OF 10 LF OF 4" PVC VACUUM PIPE, INSTALL A BUFFER TANK AND REDIRECT EXISTING BUILDING SEWERS TO BUFFER TANK. B&L BENEWAY INC. 305-743-4394.
V2009-1959	11/17/2009	Completed	\$0	Residential	FINAL INSPECTION FOR P2004-1556 CONCRETE SPALLING REPAIRS. DELETE REPAIR DOCK. ALL KEYS CONSTRUCTION 305-294-9119.
V2004-2178	10/25/2004	Completed	\$8,000	Residential	MISC. CONSTRUCTION; CONCRETE RESTORATION.
01-06-0067	06/11/2001	Completed	\$4,880	Residential	CONCRETE SPALLING ON SEAWALL AND DECK
97 20000944	12/18/1997	Completed	\$1,200	Residential	CONCRETE REPAIRS TO EXISTING CONDO AND PAINT AND COAT DECK
97 20000944	08/14/1997	Completed	\$62,800	Residential	CONCRETE REPAIRS TO EXISTING CONDO AND PAINT AND COAT DECKS
97 20000868	07/22/1997	Completed	\$60,000	Residential	REMOVE 9366 SF BUILT UP ROOF WITH CONCRETE ROOF LAYER & INSTALL INSULATION, J P STEVENS SINGLE PLY ROOF; REMOVE SHINGLE MANSARD & INSTALL STORMGUARD METAL (ALUM), INSTALL ROOF GUTTERS, DOWNSPOUTS & VINYL SOFFETTS
97 20000406	04/11/1997	Completed	\$2,355	Residential	FILL VOIDS IN EXISTING SEAWALL WITH CONCRETE AND 20 CY FILL
93 20004181	05/20/1993	Completed	\$3,300	Residential	INSTALL APPROX 130 L OF 4' HIGH ALUMINUM FENCE AROUND POOL. WITH 3' WALK GATE
B 12409	11/03/1987	Completed	\$16,545	Residential	CEMENT LAYER OVER EXISTING ROOF SURFACE

View Tax Info

[View Taxes for this Parcel](#)

Photos



AK 1399094 5/31/2011 Trade Winds West Condo

No data available for the following modules: Land, Buildings, Yard Items, Sales, Sketches (click to enlarge), TRIM Notice.

The Monroe County Property Appraiser's office maintains data on property within the County solely for the purpose of fulfilling its responsibility to secure a just valuation for ad valorem tax purposes of all property within the County. The Monroe County Property Appraiser's office cannot guarantee its accuracy for any other purpose. Likewise, data provided regarding one tax year may not be applicable in prior or subsequent years. By requesting such data, you hereby understand and agree that the [User Privacy Policy](#) | [GDPR Privacy Notice](#)
 Last Data Upload: 1/17/2025, 1:16:31 AM

[Contact Us](#)

Developed by
 SCHNEIDER
 GEOSPATIAL